



Release Notes:

Versions PA.03.00 and PB.03.00 Software

for the ProCurve Series 1800 Switches

Release PA.03.00 supports the ProCurve Switch 1800-8G (J9029A).

Release PB.03.00 supports the ProCurve Switch 1800-24G (J9028A /B).

These release notes include information on the following:

- Downloading switch software and documentation from the Web ([page 1](#))
- Clarification of operating details for certain software features ([page 5](#))
- A listing of software enhancements in these releases ([page 6](#))
- A listing of software fixes included in releases PA.02.01 through PA.03.00 and PB.02.01 through PB.03.00 ([page 8](#))

Related Publications

For the latest version of any of the publications listed below, visit the ProCurve Networking Web site at www.procurve.com. Click on **Technical support**, then **Product manuals**.

- Management and Configuration Guide

© Copyright 2008 Hewlett-Packard Company, LP. The information contained herein is subject to change without notice.

Publication Number

5991-8596
August 2008

Applicable Products

ProCurve Switch 1800-8G	(J9029A)
ProCurve Switch 1800-24G	(J9028A/B)

Trademark Credits

Microsoft®, Windows®, and Windows NT® are US registered trademarks of Microsoft Corporation. Adobe® and Acrobat® are trademarks of Adobe Systems Incorporated. Java™ is a US trademark of Sun Microsystems, Inc.

Disclaimer

HEWLETT-PACKARD COMPANY MAKES NO WARRANTY OF ANY KIND WITH REGARD TO THIS MATERIAL, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. Hewlett-Packard shall not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Hewlett-Packard assumes no responsibility for the use or reliability of its software on equipment that is not furnished by Hewlett-Packard.

Warranty

See the Customer Support/Warranty booklet included with the product.

A copy of the specific warranty terms applicable to your Hewlett-Packard products and replacement parts can be obtained from your HP Sales and Service Office or authorized dealer.

Hewlett-Packard Company
8000 Foothills Boulevard, m/s 5551
Roseville, California 95747-5551
www.procurve.com

Contents

Software Management	1
Software Updates	1
Downloading Switch Documentation and Software from the Web	1
Downloading Software to the Switch	2
Update Software	2
ProCurve Switch, Routing Switch, and Router Software Keys	3
OS/Web/Java Compatibility Table	4
Clarifications and Updates5
Enhancements6
Release PA.02.01/PB.02.01 Enhancements	6
Software fixes only; no new enhancements.	6
Release PA.02.02/PB.02.02 Enhancements	6
Software fixes only; no new enhancements.	6
Release PA.02.03/PB.02.03 Enhancements	6
Release PA.02.04/PB.02.04 Enhancements	6
Release PA.02.05/PB.02.05 Enhancements	7
Software fixes only; no new enhancements.	7
Release PA.02.06/PB.02.06 Enhancements	7
Software fixes only; no new enhancements.	7
Release PA.02.07/PB.02.07 Enhancements	7
Software fixes only; no new enhancements.	7
Release PA.02.08/PB.02.08 Enhancements	7
Software fixes only; no new enhancements.	7
Release PA.02.09/PB.02.09 Enhancements	7
Software fixes only; no new enhancements.	7
Release PA.03.00/PB.03.00 Enhancements	7
Software fixes only; no new enhancements.	7

Contents

Software Fixes in Release PA.02.01/PB.02.01 - PA.03.00/PB.03.008

Release PA.02.01/PB.02.01 8

Release PA.02.02/PB.02.02 8

Release PA.02.03/PB.02.03 8

Release PA.02.04/PB.02.04 9

Release PA.02.05/PB.02.05 9

Release PA.02.06/PB.02.06 9

Release PA.02.07/PB.02.07 9

Release PA.02.08/PB.02.08 10

Release PA.02.09/PB.02.09 10

Release PA.03.00/PB.03.00 10

Software Management

Software Updates

Check the ProCurve Networking Web site frequently for free software updates for the various ProCurve switches you may have in your network.


Downloading Switch Documentation and Software from the Web

You can download software updates and the corresponding product documentation from the ProCurve Networking Web site as described below.

To Download a Software Version:

1. Go to the ProCurve Networking Web site at:
www.procurve.com.
2. Click on **Software updates** (in the sidebar).
3. Under **Latest software**, click on **Switches**.

To Download Product Documentation: You will need the Adobe® Acrobat® Reader to view, print, and/or copy the product documentation.

1. Go to the ProCurve Networking Web site at www.procurve.com.
2. Click on **Technical support**, then **Product manuals**.
3. Click on the name of the product for which you want documentation.
4. On the resulting web page, double-click on a document you want.
5. When the document file opens, click on the disk icon  in the Acrobat® toolbar and save a copy of the file.

Downloading Software to the Switch

ProCurve Networking periodically provides switch software updates through the ProCurve Networking Web site (www.procurve.com). You can use the following method for downloading updated software to the switch.

Update Software

The Update Software Web user interface is used to update the switch software using a file provided by ProCurve Networking. To update the switch software:

1. Click the “Browse” button to select the software file.
2. Click the “APPLY” button to update the selected switch software file. You can download software files for your switch from the support section of the ProCurve Networking Web site at www.procurve.com.

Update Software	
Current Software Version	PB.02.04
Software File	<input type="text"/> <input type="button" value="Browse..."/>

- Press the **APPLY** button to update the selected switch software file.
- You can download software files for your switch from the Support section of www.procurve.com.

Note: Please be patient as the software update will take a few minutes to complete.
Expected duration is less than 5 minutes.

- **Current Software Version** – Displays the current software version in the switch.
- **Software File** – Click on the “Browse” button to select the software file.
- **Web** – Click Support, Update Software.

Note

Downloading new software does not change the current switch configuration. The switch configuration is contained in a separate file that can also be transferred, for example, for archive purposes or to be used in another switch of the same model.

ProCurve Switch, Routing Switch, and Router Software Keys

Software Letter	ProCurve Networking Products
C	1600M, 2400M, 2424M, 4000M, and 8000M
CY	Switch 8100fl Series (8108fl and 8116fl)
E	Switch 5300xl Series (5304xl, 5308xl, 5348xl, and 5372xl)
F	Switch 2500 Series (2512 and 2524), Switch 2312, and Switch 2324
G	Switch 4100gl Series (4104gl, 4108gl, and 4148gl)
H	Switch 2600 Series, Switch 2600-PWR Series: H.07.81 and earlier, or H.08.55 and greater, Switch 2600-8-PWR requires H.08.80 or greater. Switch 6108: H.07.xx and earlier
I	Switch 2800 Series (2824 and 2848)
J	Secure Router 7000dl Series (7102dl and 7203dl)
K	Switch 3500yl Series (3500yl-24G-PWR and 3500yl-48G-PWR), Switch 6200yl-24G, and 5400zl Series (5406zl, 5406zl-48G, 5412zl, and 5412zl-96G)
L	Switch 4200vl Series (4204vl, 4208vl, 4202vl-72, and 4202vl-48G)
M	Switch 3400cl Series (3400-24G and 3400-48G): M.08.51 though M.08.97, or M.10.01 and greater; Series 6400cl (6400cl-6XG CX4, and 6410cl-6XG X2): M.08.51 though M.08.95, or M.08.99 to M.08.100 and greater.
N	Switch 2810 Series (2810-24G and 2810-48G)
PA/PB	Switch 1800 Series (Switch 1800-8G – PA.xx; Switch 1800-24G – PB.xx)
Q	Switch 2510 Series (2510-24)
T	Switch 2900 Series (2900-24G, and 2900-48G)
VA/VB	Switch 1700 Series (Switch 1700-8 - VA and 1700-24 - VB)
WA	ProCurve Access Point 530
WS	ProCurve Wireless Edge Services xl Module and the ProCurve Redundant Wireless Services xl Module
numeric	Switch 9408sl, Switch 9300 Series (9304M, 9308M, and 9315M), Switch 6208M-SX and Switch 6308M-SX (Uses software version number only; no alphabetic prefix. For example 07.6.04.)

OS/Web/Java Compatibility Table

The switch web agent supports the following combinations of OS browsers and Java Virtual Machines:

Operating System	Internet Explorer	Java
Windows NT 4.0 SP6a	5.00, 5.01 5.01, SP1 6.0, SP1	Sun Java 2 Runtime Environment: – Version 1.3.1.12 – Version 1.4.2.05
Windows 2000 Pro SP4	5.05, SP2 6.0, SP1	
Windows XP Pro SP2	6.0, SP1	Sun Java 2 Runtime Environment: – Version 1.5.0.02
Windows Server SE 2003 SP1	6.0, SP1	

Clarifications and Updates

There are currently no clarification or updates to existing documentation related to the Series 1800 Switches, or PA.03.xx and PB.03.xx code.

Enhancements

Unless otherwise noted, each new release includes the enhancements added in all previous releases.

Enhancements are listed in chronological order, oldest to newest software release.

Release PA.02.01/PB.02.01 Enhancements

Software fixes only; no new enhancements.

Release PA.02.02/PB.02.02 Enhancements

Software fixes only; no new enhancements.

Release PA.02.03/PB.02.03 Enhancements

Enhancements in Release PA.02.03/PB.02.03

- **Enhancement** — Broadcast storm control (1800-8G).
-

Release PA.02.04/PB.02.04 Enhancements

Enhancements in Release PA.02.04/PB.02.04 (never released)

- **Enhancement** — Now passes BPDU packets to an upstream switch with spanning tree to detect and prevent loops; BPDU packets can also pass 802.1X authentication information.
 - **Enhancement** — The Port Statistics Web page now displays the status of the port, including speed and duplex.
 - **Enhancement** — Text-readable configuration files can be downloaded from the Web user interface.
 - **Enhancement** — The management VLAN is configurable.
-

Release PA.02.05/PB.02.05 Enhancements

Software fixes only; no new enhancements.

Release PA.02.06/PB.02.06 Enhancements

Software fixes only; no new enhancements.

Release PA.02.07/PB.02.07 Enhancements

Software fixes only; no new enhancements.

Release PA.02.08/PB.02.08 Enhancements

Software fixes only; no new enhancements.

Release PA.02.09/PB.02.09 Enhancements

Software fixes only; no new enhancements.

Release PA.03.00/PB.03.00 Enhancements

Software fixes only; no new enhancements.

Software Fixes in Release PA.02.01/PB.02.01 - PA.03.00/PB.03.00

Software fixes are listed in chronological order, oldest to newest software release.

Unless otherwise noted, each new release includes the fixes added in all previous releases.

PA.02.01 and PB.02.01 were the first software releases for the ProCurve 1800 Series switches.

Release PA.02.01/PB.02.01

Problems Resolved in Release PA.02.01/PB.02.01

- **Original Release**

Release PA.02.02/PB.02.02

Problems Resolved in Release PA.02.02/PB.02.02 (never released)

- **VLAN** — Adding VLAN members will cause the original setting PVID change to “VID=1.”
 - **Web UI** — Link to ProCurve Web site is fixed.
-

Release PA.02.03/PB.02.03

Problems Resolved in Release PA.02.03/PB.02.03

- **Trunk** — VLAN assignments revert to default assignments when a trunk is created.
 - **System** — The DHCP does not get gateway IP/subnet mask.
 - **System** — The DHCP is not activated when link changes state from down to up.
 - **Jumbo Frames** — Cannot disable Jumbo Frames from Web user interface (1800-8G).
 - **LLDP** — Not all LLDP counters are cleared after a factory reset.
-

Release PA.02.04/PB.02.04

Problems Resolved in Release PA.02.04/PB.02.04 (never released)

- **Web UI** — An incorrect image for the 1800-8G is displayed.
 - **Web UI** — The configuration menus for LACP and static trunk have been improved to make configuration easier and to prevent errors.
 - **Web UI** — Incorrect VLAN information is displayed for the LACP trunk when it is added into a VLAN. The LACP group number is displayed instead of the VLAN information.
 - **LACP** — The factory reset does not clear the LACP configuration.
 - **System** — When a DHCP request fails, the switch now retries after 30 seconds.
-

Release PA.02.05/PB.02.05

Problems Resolved in Release PA.02.05/PB.02.05 (never released)

Release PA.02.06/PB.02.06

Problems Resolved in Release PA.02.06/PB.02.06

- **System** — J9028B (1800-24G Rev. B) support added.
-

Release PA.02.07/PB.02.07

Problems Resolved in Release PA.02.07/PB.02.07

- **Web UI** — Help pages have been updated.
 - **Web UI** — PVID display may be incorrect after deleting a VLAN or IP address (1800-24G).
 - **System** — Uploading configuration does not copy the management VLAN or IP address information to the switch.
 - **System** — Looping ports 1 and 2 fails to do a factory reset when management VLAN is not set to its default of 1.
-

- **VLAN** — Switch may fail to add all of the selected ports into a new VLAN when the management VLAN has been changed from the default.
 - **SNMP** — SNMP community name “private” is always readable.
 - **LLDP** — Not all LLDP counters are cleared after a factory reset.
-

Release PA.02.08/PB.02.08

Problems Resolved in Release PA.02.08/PB.02.08

- **IP Address Assignment (4000144815)** — A valid gateway or IP address with 0 (zero) in the 4th octet cannot be assigned as a gateway.
 - **Web UI** — Clarified the help description of tagged only and PVID fields on the VLAN Configuration screen.
-

Release PA.02.09/PB.02.09

Problems Resolved in Release PA.02.09/PB.02.09

- **Mini-GBIC (PR_1000741315)** — J9028B does not link when Rev. C mini-GBIC is installed.
-

Release PA.03.00/PB.03.00

Problems Resolved in Release PA.03.00/PB.03.00

- **Trunks (PR_1000744340 / PR_0000003783)** — Use of ports 1 and 2 in a trunk may trigger a return to factory default configuration under certain conditions. This fix adds a warning message in the Trunk -> Membership and Trunk -> LACP Setup web pages.
 - **SFP (PR_1000757008 / PR_0000003787)** — When a fiber mini-GBIC is inserted in port 23/24 of a 1800-24G switch, the fiber speed/duplex may be reported differently in the Ports-> Configuration page, versus the Ports-> Statistics page.
 - **SFP** — When a fiber mini-GBIC is inserted in 1800-24G (J9028B), some fiber mini-GBIC types do not display properly in the System -> Information page; they erroneously display the type as 10/100/1000-T.
-



© 2008

Hewlett-Packard Development Company, LP.
The information contained herein is subject to
change without notice.

August 2008

Manual Part Number

5991-8596