



# Release Notes:

## Version Q.11.17 Software

*for the ProCurve 2510-24 Switch*

---

These release notes include information on the following:

- Downloading switch software and documentation from the Web ([page 1](#))
- Clarification of operating details for certain software features ([page 8](#))
- A listing of software enhancements in this release ([page 8](#))
- A listing of software fixes included in releases Q.10.02 through Q.11.17 ([page 15](#))

### **Related Publications**

For the latest version of the product documentation for your switch, visit the ProCurve Networking Web site at [www.procurve.com/manuals/](http://www.procurve.com/manuals/).

---

© Copyright 2008 Hewlett-Packard Company, LP. The information contained herein is subject to change without notice.

### Publication Number

5991-6274  
October 2008

### Applicable Products

ProCurve Switch 2510-24G	(J9019A)
ProCurve Switch 2510-24G	(J9019B)

### Trademark Credits

Microsoft®, Windows®, and Windows NT® are US registered trademarks of Microsoft Corporation. Adobe® and Acrobat® are trademarks of Adobe Systems Incorporated. Java™ is a US trademark of Sun Microsystems, Inc.

### Software Credits

SSH on ProCurve Switches is based on the OpenSSH software toolkit. This product includes software developed by the OpenSSH Project for use in the OpenSSH Toolkit. For more information on OpenSSH, visit

<http://www.openssh.com>.

SSL on ProCurve Switches is based on the OpenSSL software toolkit. This product includes software developed by the OpenSSL Project for use in the OpenSSL Toolkit. For more information on OpenSSL, visit

<http://www.openssl.org>.

This product includes cryptographic software written by Eric Young (eay@cryptsoft.com). This product includes software written by Tim Hudson (tjh@cryptsoft.com)

### Disclaimer

HEWLETT-PACKARD COMPANY MAKES NO WARRANTY OF ANY KIND WITH REGARD TO THIS MATERIAL, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. Hewlett-Packard shall not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Hewlett-Packard assumes no responsibility for the use or reliability of its software on equipment that is not furnished by Hewlett-Packard.

### Warranty

See the Customer Support/Warranty booklet included with the product.

A copy of the specific warranty terms applicable to your Hewlett-Packard products and replacement parts can be obtained from your HP Sales and Service Office or authorized dealer.

Hewlett-Packard Company  
8000 Foothills Boulevard, m/s 5551  
Roseville, California 95747-5551  
[www.procurve.com](http://www.procurve.com)

# Contents

<b>Software Management</b> .....	<b>1</b>
Software Updates .....	1
Downloading Switch Documentation and Software from the Web .....	1
Downloading Software to the Switch .....	2
TFTP Download from a Server .....	3
Xmodem Download From a PC or Unix Workstation .....	4
Saving Configurations While Using the CLI .....	5
ProCurve Switch, Routing Switch, and Router Software Keys .....	6
OS/Web/Java Compatibility Table .....	7
Minimum Supported Software .....	7
<b>Clarifications and Updates</b> .....	<b>8</b>
<b>Enhancements</b> .....	<b>8</b>
Release Q.10.02 Enhancements .....	8
Release Q.10.03 Enhancements .....	8
Release Q.10.04 Enhancements .....	8
Release Q.10.05 Enhancements .....	8
Release Q.10.06 Enhancements .....	9
Release Q.10.07 Enhancements .....	9
Release Q.10.08 Enhancements .....	10
Release Q.10.09 Enhancements .....	10
Release Q.11.01 Enhancements .....	10
Release Q.11.02 Enhancements .....	10
Release Q.11.03 Enhancements .....	11
Release Q.11.04 Enhancements .....	11
Release Q.11.05 Enhancements .....	11
Release Q.11.06 Enhancements .....	11
Release Q.11.07 Enhancements .....	11
Release Q.11.08 Enhancements .....	11

Release Q.11.09 Enhancements .....	11
Release Q.11.10 Enhancements .....	11
Release Q.11.11 Enhancements .....	11
Release Q.11.12 Enhancements .....	12
10/100 Auto Negotiation .....	12
Release Q.11.13 Enhancements .....	13
Release Q.11.14 Enhancements .....	14
Release Q.11.15 Enhancements .....	14
Release Q.11.16 Enhancements .....	14
Release Q.11.17 Enhancements .....	14
<b>Software Fixes .....</b>	<b>15</b>
Release Q.10.02 .....	15
Release Q.10.03 .....	16
Release Q.10.04 .....	17
Release Q.10.05 .....	18
Release Q.10.06 .....	18
Release Q.10.07 .....	18
Release Q.10.08 .....	19
Release Q.10.09 .....	19
Release Q.11.01 .....	19
Release Q.11.02 .....	21
Release Q.11.03 .....	21
Release Q.11.04 .....	21
Release Q.11.05 .....	21
Release Q.11.06 .....	22
Release Q.11.07 .....	22
Release Q.11.08 .....	22
Release Q.11.09 .....	23
Release Q.11.10 .....	23
Release Q.11.11 .....	23
Release Q.11.12 (Never released) .....	24

Release Q.11.13 (Not a public release) .....	24
Release Q.11.14 (Not a public release) .....	25
Release Q.11.15 (Never released) .....	25
Release Q.11.16 (Never released) .....	25
Release Q.11.17 .....	26

# Software Management

---

---

## Software Updates

Check the ProCurve Networking Web site frequently for free software updates for the various ProCurve switches you may have in your network.

---

## Downloading Switch Documentation and Software from the Web

You can download software updates and the corresponding product documentation from the ProCurve Networking Web site as described below.

### To Download a Software Version:

1. Go to the ProCurve Networking Web site at:  
[www.procurve.com](http://www.procurve.com).
2. Click on **Software updates** (in the sidebar).
3. Under **Latest software**, click on **Switches**.

**To Download Product Documentation:** You will need the Adobe® Acrobat® Reader to view, print, and/or copy the product documentation.

1. Go to the ProCurve Networking Web site at [www.procurve.com](http://www.procurve.com).
2. Click on **Technical support**, then **Product manuals**.
3. Click on the name of the product for which you want documentation.
4. On the resulting web page, double-click on a document you want.
5. When the document file opens, click on the disk icon in the Acrobat® toolbar and save a copy of the file.

## Downloading Software to the Switch

ProCurve Networking periodically provides switch software updates through the ProCurve Networking Web site ([www.procurve.com](http://www.procurve.com)). After you acquire the new software file, you can use one of the following methods for downloading it to the switch:

- For a TFTP transfer from a server, do either of the following:
  - Select **Download OS** in the Main Menu of the switch's menu interface and use the (default) **TFTP** option.
  - Use the **copy tftp** command in the switch's CLI (see below).
- For an Xmodem transfer from a PC or Unix workstation, do either of the following:
  - Select **Download OS** in the Main Menu of the switch's menu interface and select the **Xmodem** option.
  - Use the **copy xmodem** command in the switch's CLI (page 4).
- Use the download utility in ProCurve Manager Plus.

---

### Note

Downloading new software does not change the current switch configuration. The switch configuration is contained in a separate file that can also be transferred, for example, for archive purposes or to be used in another switch of the same model.

---

This section describes how to use the CLI to download software to the switch. You can also use the menu interface for software downloads. For more information, refer to the *Management and Configuration Guide* for your switch.

## TFTP Download from a Server

**Syntax:** `copy tftp flash <ip-address> <remote-os-file> [< primary | secondary >]`


Note that if you do not specify the flash destination, the TFTP download defaults to the primary flash.

For example, to download a software file named Q\_10\_0x.swi from a TFTP server with the IP address of 10.28.227.103:

1. Execute the copy command as shown below:

```
ProCurve # copy tftp flash 10.28.227.103 Q_10_0x.swi
The primary OS image will be deleted. continue [y/n]? Y
03125K
```

2. When the switch finishes downloading the software file from the server, it displays the progress message shown in figure 1. When the CLI prompt re-appears, the switch is ready to reboot to activate the downloaded software.

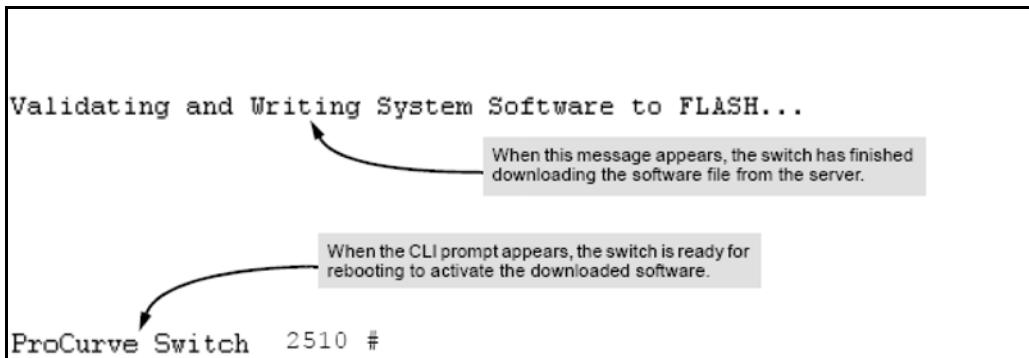

**Figure 1. Message Indicating the Switch Is Ready To Activate the Downloaded Software**

3. Use the **show flash** command to verify that the new software version is in the expected flash area (primary or secondary)
4. Reboot the switch from the flash area that holds the new software (primary or secondary).

After the switch reboots, it displays the CLI or Main Menu, depending on the **Logon Default** setting last configured in the menu's Switch Setup screen.

## Xmodem Download From a PC or Unix Workstation

This procedure assumes that:

- The switch is connected via the Console RS-232 port to a PC operating as a terminal. (Refer to the Installation and Getting Started Guide you received with the switch for information on connecting a PC as a terminal and running the switch console interface.)
- The switch software is stored on a disk drive in the PC.
- The terminal emulator you are using includes the Xmodem binary transfer feature. (For example, in the HyperTerminal application included with Windows NT, you would use the Send File option in the Transfer dropdown menu.)

Using Xmodem and a terminal emulator, you can download a switch software file to either primary or secondary flash using the CLI.

**Syntax:** copy xmodem flash [primary | secondary]

1. To reduce the download time, you may want to increase the baud rate in your terminal emulator and in the switch to a value such as 115200 bits per second. (The baud rate must be the same in both devices.) For example, to change the baud rate in the switch to 115200, execute this command:

```
ProCurve(config)# console baud-rate 115200
```

(If you use this option, be sure to set your terminal emulator to the same baud rate.)

Changing the console baud-rate requires saving to the Startup Config with the "write memory" command. Alternatively, you can logout of the switch and change your terminal emulator speed and allow the switch to AutoDetect your new higher baud rate (i.e. 115200 bps)

2. Execute the following command in the CLI:

```
ProCurve # copy xmodem flash primary
The primary OS image will be deleted. continue [y/n]? Y
Press 'Enter' and start XMODEM on your host...
```

3. Execute the terminal emulator commands to begin the Xmodem transfer. For example, using HyperTerminal:
  - a. Click on **Transfer**, then **Send File**.
  - b. Type the file path and name in the **Filename** field.
  - c. In the Protocol field, select **Xmodem**.
  - d. Click on the **Send** button

The download can take several minutes, depending on the baud rate used in the transfer.

4. If you increased the baud rate on the switch ([step 1](#)), use the same command to return it to its previous setting. HP recommends a baud rate of 9600 bits per second for most applications. Remember to return your terminal emulator to the same baud rate as the switch.

5. Use the **show flash** command to verify that the new software version is in the expected flash area (primary or secondary)
6. Reboot the switch from the flash area that holds the new software (primary or secondary).

After the switch reboots, it displays the CLI or Main Menu, depending on the **Logon Default** setting last configured in the menu's Switch Setup screen.

---

## Saving Configurations While Using the CLI

The switch operates with two configuration files:

- **Running-Config File:** Exists in volatile memory and controls switch operation. Rebooting the switch erases the current running-config file and replaces it with an exact copy of the current startup-config file. To save a configuration change, you must save the running configuration to the startup-config file.
- **Startup-Config File:** Exists in flash (non-volatile) memory and preserves the most recently-saved configuration as the “permanent” configuration. When the switch reboots for any reason, an exact copy of the current startup-config file becomes the new running-config file in volatile memory.

When you use the CLI to make a configuration change, the switch places the change in the running-config file. If you want to preserve the change across reboots, you must save the change to the startup-config file. Otherwise, the next time the switch reboots, the change will be lost. There are two ways to save configuration changes while using the CLI:

- Execute **write memory** from the Manager, Global, or Context configuration level.
- When exiting from the CLI to the Main Menu, press **[Y]** (for Yes) when you see the “save configuration” prompt:

```
Do you want to save current configuration [y/n] ?
```

## Software Management

ProCurve Switch, Routing Switch, and Router Software Keys

# ProCurve Switch, Routing Switch, and Router Software Keys

Software Letter	ProCurve Networking Products
<b>C</b>	1600M, 2400M, 2424M, 4000M, and 8000M
<b>CY</b>	Switch 8100fl Series (8108fl and 8116fl)
<b>E</b>	Switch 5300xl Series (5304xl, 5308xl, 5348xl, and 5372xl)
<b>F</b>	Switch 2500 Series (2512 and 2524), Switch 2312, and Switch 2324
<b>G</b>	Switch 4100gl Series (4104gl, 4108gl, and 4148gl)
<b>H</b>	Switch 2600 Series, Switch 2600-PWR Series: H.07.81 and earlier, or H.08.55 and greater, Switch 2600-8-PWR requires H.08.80 or greater. Switch 6108: H.07.xx and earlier
<b>I</b>	Switch 2800 Series (2824 and 2848)
<b>J</b>	Secure Router 7000dl Series (7102dl and 7203dl)
<b>K</b>	Switch 3500yl Series (3500yl-24G-PWR and 3500yl-48G-PWR), Switch 6200yl-24G, 5400zl Series (5406zl, 5406zl-48G, 5412zl, 5412zl-96G) and Switch 8212zl.
<b>L</b>	Switch 4200vl Series (4204vl, 4208vl, 4202vl-72, and 4202vl-48G)
<b>M</b>	Switch 3400cl Series (3400-24G and 3400-48G): M.08.51 through M.08.97, or M.10.01 and greater; Series 6400cl (6400cl-6XG CX4, and 6410cl-6XG X2 ): M.08.51 through M.08.95, or M.08.99 to M.08.100 and greater.
<b>N</b>	Switch 2810 Series (2810-24G and 2810-48G)
<b>PA/PB</b>	Switch 1800 Series (Switch 1800-8G – PA.xx; Switch 1800-24G – PB.xx)
<b>Q</b>	Switch 2510 Series (2510-24)
<b>R</b>	Switch 2610 Series (2610-24, 2610-24/12PWR, 2610-24-PWR, 2610-48 and 2610-48-PWR)
<b>T</b>	Switch 2900 Series (2900-24G, and 2900-48G)
<b>U</b>	Switch 2510-48
<b>VA/VB</b>	Switch 1700 Series (Switch 1700-8 - VA and 1700-24 - VB)
<b>WA</b>	ProCurve Access Point 530
<b>WS</b>	ProCurve Wireless Edge Services xl Module and the ProCurve Redundant Wireless Services xl Module
<b>WT</b>	ProCurve Wireless Edge Services zl Module and the ProCurve Redundant Wireless Services zl Module
<b>Y</b>	Switch 2510G Series (2510G-24 and 2510G-48)
<b>numeric</b>	Switch 9408sl, Switch 9300 Series (9304M, 9308M, and 9315M), Switch 6208M-SX and Switch 6308M-SX (Uses software version number only; no alphabetic prefix. For example 07.6.04.)

Version Q.10.01 is the first software release for the ProCurve 2510-24 switch.

## OS/Web/Java Compatibility Table

The switch web agent supports the following combinations of OS browsers and Java Virtual Machines:

Operating System	Internet Explorer	Java
Windows NT 4.0 SP6a	5.00, 5.01 5.01, SP1 6.0, SP1	Sun Java 2 Runtime Environment: – Version 1.3.1.12 – Version 1.4.2.05
Windows 2000 Pro SP4	5.05, SP2 6.0, SP1	
Windows XP Pro SP2	6.0, SP2 and 7.0	Sun Java 2 Runtime Environment: – Version 1.5.0_11, Version 1.6.0
Windows Server SE 2003 SP2		
Windows Vista		

## Minimum Supported Software

The following table describes what software version is required for each product. All products support the latest software version.

Product	Minimum Supported Software Version
J9019A	Q.10.01
J9019B	Q.11.06
ProCurve 100-BX-D SFP-LC Transceiver (J9099B)	Q.11.16
ProCurve 100-BX-U SFP-LC Transceiver (J9100B)	Q.11.16
ProCurve 1000-BX-D SFP-LC Mini-GBIC (J9142B)	Q.11.16
ProCurve 1000-BX-U SFP-LC Mini-GBIC (J9143B)	Q.11.16

# Clarifications and Updates

---

There are currently no clarification or updates to existing documentation related to the ProCurve 2510 switch or software Q.11.17.

## Enhancements

---

Unless otherwise noted, each new release includes the enhancements added in all previous releases.

Enhancements are listed in chronological order, oldest to newest software release.

### Release Q.10.02 Enhancements

Release Q.10.02 includes the following enhancements:

- **Enhancement (PR\_1000351445)** — The "show tech transceiver" CLI command output now contains the HP part number and revision information for all transceivers on the switch

### Release Q.10.03 Enhancements

Release Q.10.03 includes the following enhancements:

- **Enhancement (PR\_1000379804)** — Historical information about MAC addresses that have been moved has been added to the **show tech** command output.

### Release Q.10.04 Enhancements

Release Q.10.04 (never released) includes the following enhancements:

- **Enhancement (PR\_1000365862)** — This portion of the enhancement added the option of configuring ports that had been previously disabled by BPDU Protection to be automatically re-enabled.
- **Enhancement (PR\_1000373226)** — Support was added for the J9054B 100-FX SFP-LC.

### Release Q.10.05 Enhancements

*This release contains software fixes only, no new enhancements.*

## Release Q.10.06 Enhancements

*Never released.*

## Release Q.10.07 Enhancements

Release Q.10.07 includes the following enhancements:

- **Protected Ports:** To provide internet access to users but prevent them from accessing each other, use the **protected-ports** command. The command applies per-port and filters the outbound traffic from the port. See “Configuring Protected Ports” in the “Configuring and Monitoring Port Security” chapter of the *Access Security Guide* for more information.
- **Show tech transceivers:** The show tech transceivers command allows you to remotely identify transceiver type and revision number without having to physically remove an installed transceiver from its slot. Additionally, the command displays real-time status information about all installed transceivers, including non-operational transceivers. See the chapter titled “Port Status and Basic Configuration” in the *Management and Configuration Guide* for your switch.
- **Scheduled reload:** The scheduled reload feature allows you to reboot the switch at times that are more convenient. The new parameters are “**at**” and “**after**”. The **reload at** command allows you to specify a specific time for the reboot. The **reload after** command allows you to reboot the switch after a specified amount of time has passed. See the chapter titled “Switch Memory and Configuration” in the *Management and Configuration Guide* for your switch.
- **Spanning-tree admin-edge-port:** During spanning tree establishment, ports with **admin-edge-port** enabled transition immediately to the forwarding state. If a bridge or switch is detected on the segment, the port automatically operates as non-edge, not enabled. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Spanning-tree auto-edge-port:** Supports the automatic identification of edge ports. The port will look for BPDUs for 3 seconds; if there are none it begins forwarding packets. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Spanning-tree BPDU Filtering:** The bpd-filter option forces a port to **always** stay in the forwarding state and be excluded from standard STP operation. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Spanning-tree BPDU Protection:** A security feature designed to protect the active STP topology by preventing spoofed BPDU packets from entering the STP domain. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.

## Enhancements

### Release Q.10.08 Enhancements

- **Spanning-tree root-guard:** When a port is enabled as **root-guard**, it cannot be selected as the root port even if it receives superior STP BPDUs. The port is assigned an “alternate” port role and enters a blocking state if it receives superior STP BPDUs. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Spanning-tree tcn-guard:** Causes the port to stop propagating received topology change notifications and topology changes to other ports. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Loop Protection:** Protects against the formation of loops when an unmanaged device on the network drops spanning tree packets. Transmits loop protocol packets out ports on which loop protection has been enabled. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Show spanning-tree root-history:** Displays the spanning-tree root changes history information. See the chapter titled “Multiple Instance Spanning Tree Operation” in the *Advanced Traffic Management Guide* for your switch.
- **Added Web-based and MAC-based authentication:** Provides port-based security measures for protecting private networks and the switch itself from unauthorized access. See the chapter titled “Web and MAC Authentication” in the *Access Security Guide* for your switch.

### Release Q.10.08 Enhancements

*Never released.*

### Release Q.10.09 Enhancements

*Never released.*

### Release Q.11.01 Enhancements

*No enhancements, software fixes only. Never released.*

### Release Q.11.02 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.03 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.04 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.05 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.06 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.07 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.08 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.09 Enhancements

*No enhancements, software fixes only. Not a public release.*

## Release Q.11.10 Enhancements

*No enhancements, software fixes only. Never released.*

## Release Q.11.11 Enhancements

*No enhancements, software fixes only.*

## Release Q.11.12 Enhancements

Release Q.11.12 (never released) includes the following enhancements:

- **Enhancement (PR\_1000793342)** — The Auto-10-100 parameter was added as a port configuration option for speed-duplex.

### 10/100 Auto Negotiation

The 10/100 auto-negotiation feature allows a port to establish a link with a port at the other end at either 10 Mbps or 100 Mbps, using the highest mutual speed and duplex mode available. Only these speeds are allowed with this setting. You can configure one or more of the following port parameters using this command:

```
Syntax [no] interface < port-list >
        [< disable | enable >]
        Disables or enables the port for network traffic. Does not
        use the no form of the command. (Default: enable.)
        [speed-duplex < auto-10|10-full|10-half|100-full|100-half|auto|
        auto-100|1000-full|auto-10-100>]
        Specifies the port's data transfer speed and mode. Does
        not use the no form of the command.
        (Default: auto.)
```

Note that in the above syntax you can substitute an “**int**” for “**interface**”; that is: **int < port-list >**.

For example, to configure port C5 for auto-10-100, enter this command:

```
ProCurve(config)# int c5 speed-duplex auto-10-100
```

You can configure and view the port settings by using the menu. Select **Switch Configuration > Port/Trunk Settings**. An example of the Menu display is shown below.

```
===== TELNET - MANAGER MODE =====
                          Switch Configuration - Port/Trunk Settings

Port   Type      Enabled   Mode      Flow Ctrl  Group  Type
-----+-----
A1     1000T      | Yes     Auto-10-100  Disable
A2     1000T      | Yes     Auto-10-100  Disable
A3     1000T      | Yes     Auto         Disable
A4     1000T      | Yes     Auto         Disable
A5     1000T      | Yes     Auto         Disable
A6     1000T      | Yes     Auto         Disable
A7     1000T      | Yes     Auto         Disable   Trk1  Trunk
A8     1000T      | Yes     Auto         Disable   Trk2  Trunk

Actions->  Cancel      Edit      Save      Help

Cancel changes and return to previous screen.
Use arrow keys to change action selection and <Enter> to execute action.
```

You can use the **show interface config** command to view the port settings, as shown below.

```
ProCurve(config)# show interface config

Port Settings

Port  Type      | Enabled Mode      Flow Ctrl MDI
-----+-----
A1    100/1000T | Yes   Auto-10-100  Disable  Auto
A2    100/1000T | Yes   Auto-10-100  Disable  Auto
A3    100/1000T | Yes   Auto         Disable  Auto
A4    100/1000T | Yes   Auto         Disable  Auto
A5    100/1000T | Yes   Auto         Disable  Auto
A6    100/1000T | Yes   Auto         Disable  Auto
```

## Release Q.11.13 Enhancements

*No enhancements, software fixes only. Not a public release.*

## Release Q.11.14 Enhancements

*No enhancements, software fixes only. Not a public release.*

## Release Q.11.15 Enhancements

*No enhancements, software fixes only. Never released.*

## Release Q.11.16 Enhancements

Release Q.11.16 (never released) includes the following enhancements:

- **Enhancement (PR\_1000406763)** — New command output was added to the CLI response to the **show tech** command.
- **Enhancement (PR\_0000010783)** — Support was added for the following products.
  - J9099B - ProCurve 100-BX-D SFP-LC Transceiver
  - J9100B - ProCurve 100-BX-U SFP-LC Transceiver
  - J9142B - ProCurve 1000-BX-D SFP-LC Mini-GBIC
  - J9143B - ProCurve 1000-BX-U SFP-LC Mini-GBIC

## Release Q.11.17 Enhancements

*No enhancements, software fixes only.*

# Software Fixes

---

Software fixes are listed in chronological order, from the oldest to the newest software release.

Unless otherwise noted, each new release includes the fixes added in all previous releases.

Release Q.10.01 is the first software release for the ProCurve 2510-24 switch.

---

## Release Q.10.02

### Problems Resolved in Release Q.10.02 (not a general release)

- **802.1x (PR\_1000366179)** — Open VLAN supplicants that fail 802.1X authentication can access the authorized VLAN.
  - **802.1x (PR\_1000366395)** — Enabling port-access authentication on gig ports causes the switch to crash.
  - **Authorization (PR\_1000365285)** — IP Authorized Managers behaves incorrectly with regard to telnet access.
  - **Auto-TFTP (PR\_1000362661)** — When auto-TFTP is enabled, the switch crashes after displaying "Rebooting the System" after a **reload** command is issued from the CLI.
  - **CLI (PR\_1000358129)** — The command line interface (CLI) becomes unresponsive after running RMON traps code.
  - **Crash (PR\_1000368540)** — The switch may crash with a message similar to:  

```
Software exception at parser.c:8012 -- in 'mSess2', task ID =  
0x90e10e0 -> ASSERT: failed.
```
  - **Crash (PR\_1000360267)** — Removing a VLAN that is assigned as the unauthorized VID may cause the switch to crash with a message similar to:  

```
Software exception at vls_dyn_reconfig.c:2640 -- in 'mSnmpCtrl',  
task ID = 0x170 -> ASSERT: failed.
```
  - **Enhancement (PR\_1000351445)** — The show tech transceiver CLI command output now contains the HP part number and revision information for all transceivers on the switch.
  - **Hang (PR\_1000365567)** — Switch may hang and ports may fail to link up.
  - **Hang (PR\_1000346328)** — RMON alarms/events configuration files may become corrupt and prevent initialization, resulting in failure to boot.
-

- **RADIUS (PR\_1000358525)** — Attributes that were overridden by RADIUS (CoS, Rate, and ACL) remain active if an authenticated user fails to send EAP-LOGOFF.

## Release Q.10.03

### Problems Resolved in Release Q.10.03 *(not a general release)*

- **802.1X (PR\_1000378481)** — 802.1X authentication needs to be limited to two users per port.
- **CLI (PR\_1000364628)** — The command output from **show ip rip peer** yields an improperly formatted peer IP address.
- **CLI/Config (PR\_1000342824)** — Configuring a port for MDI will cause the port to act as MDI-X, and vice versa.
- **CLI/Config (PR\_1000375830)** — When using the **no vlan** command, the user is asked if they want to remove the VLAN. Answering **no** will result in the VLAN being removed anyway.
- **CLI/LLDP (PR\_1000377191)** — Output from the CLI command, **show lldp info remote-device <port>** shows a blank field for the chassis ID.
- **Crash (PR\_1000382962)** — Executing the CLI command, **sho int** on a mini-GBIC that is not linked, may cause the switch to crash with a message similar to:

```
Divide by Zero Error: IP=0x8017becc Task='mSess1' Task ID=0x834b19d0
fp:0x00000018 sp:0x834b0d20 ra:0x8017be18 sr:0x1000fc01 Division by
0 Crash at cli_opershow_action.c:1298.
```
- **Crash (PR\_1000386489)** — The switch may crash with a message similar to:

```
Unaligned Access: Virtual Addr=0xa3e2dad7 IP=0x801f8234
Task='eDrvPoll' Task ID=0x81b02650 fp:0x81ecce90 sp:0x81b02538
ra:0x801f8209
```
- **Enhancement (PR\_1000379804)** — Historical information about MAC addresses that have been moved has been added to the **show tech** command output.
- **Syslog (PR\_1000379802)** — Forwarding of event log message to a configured syslog server is not disabled when a specific event log message has been disabled via MIB.
- **Web/RADIUS (PR\_1000368520)** — Web Authentication does not authenticate clients due to a failure to send RADIUS requests to the configured server.
- **Web-UI (PR\_1000373711)** — Attempting to access the Web UI of a stack member without being logged on as Manager returns a "404 Page Not Found" error.

## Release Q.10.04

### Problems Resolved in Release Q.10.04 (Never released.)

- **Auto MDIX (PR\_1000355099)** — Forced mode auto-MDIX on 10/100 ports does not function.
- **CLI (PR\_1000380660)** — The **show tech transceivers** CLI command displays the wrong message when inserting an "A" version transceiver into a switch that only supports "B" version transceivers. Also, "B" version CX4 transceivers show up as "A" and "A" version SR, LR, and ER transceivers show up as "B" versions.
- **CLI (PR\_1000390385)** — The CLI help text for **span bpdu-protection-timeout** is incorrect; it erroneously displays the help text for **span hello-time**.
- **CLI/Config (PR\_1000377413)** — The CLI does not prevent an invalid configuration from being loaded. With this fix, configurations with excess IP Address QoS entries will result in an error message and the config file will not load.
- **CLI/config (PR\_1000391119)** — Copying a configuration file to a switch with a BPDU protection time-out value set may produce an error similar to:

```
CCCCCline: 10007. 1200: Error setting configuration
```
- **CLI/LLDP (PR\_1000377191)** — Output from the CLI command, **show lldp info remote-device <port>** shows a blank field for the chassis ID.
- **Crash (PR\_1000357252)** — When authenticating with Web UI using a Radius server, the switch may crash with a message similar to:

```
TLB Miss: Virtual Addr=0x00211dc4 IP=0x00211dc4 Task='tHttpd' Task  
ID=0x83413db0 fp:0x00000000 sp:0x83413c69
```
- **Enhancement (PR\_1000365862)** — This portion of the enhancement added the option of configuring ports that had been previously disabled by BPDU Protection to be automatically re-enabled.
- **Enhancement (PR\_1000373226)** — Support was added for the J9054B 100-FX SFP-LC.
- **GVRP (PR\_1000385623)** — The switch does not process GVRP frames when the receiving port is tagged, so no VLANs are learned from that source.
- **Trunking (PR\_1000238829)** — Trunks numbered **trk10** and greater cause the output from the CLI command **show span** output to be misaligned.
- **Web UI (PR\_1000326265)** — Attempting to access the Web UI of a stack member hangs the browser.

## Release Q.10.05

### Problems Resolved in Release Q.10.05

- **Daylight savings (PR\_1000364740)** — Due to the passage of the Energy Policy Act of 2005, Pub. L. no. 109-58, 119 Stat 594 (2005), starting in March 2007 daylight time in the United States will begin on the second Sunday in March and end on the first Sunday in November.

## Release Q.10.06

### Problems Resolved in Release Q.10.06 (Never released.)

- **CLI (PR\_1000240838)** — If an invalid time is entered using **clock set** command, the switch responds with an "invalid date" error.
- **CLI (PR\_1000199785)** — tab help (command-completion) for "IP RIP authentication" is inaccurate.
- **CLI (PR\_1000373443)** — The CLI **update** command help and confirmation message is misleading and confusing.
- **Traceroute (PR\_1000379199)** — The **traceroute** time is inaccurate, appears to be one decimal place off.
- **Menu (PR\_1000392862)** — The menu will allow values greater than 720 seconds to be entered for the SNMP poll interval without error.

## Release Q.10.07

### Problems Resolved in Release Q.10.07

- **BPDU Protection (PR\_1000395569)** — BPDU-protection fails after module is hot-swapped.
- **IP Connectivity (PR\_1000418378)** — The switch incorrectly updates its ARP table when a client, which is configured with a valid IP address for a valid VLAN, is connected to a port in another VLAN on the switch. This will result in loss of connectivity for the valid client in the appropriate VLAN.
- **Trunking (PR\_1000395062)** — When one port of a trunk fails or is disconnected. The trunk does not failover properly.
- **Trunking (PR\_1000410057)** — When a trunk port becomes inactive or cable is unplugged it affects communication through other trunks.
- **Crash (PR\_1000413907)** — Switch crashes when stacking.

- **CLI (PR\_1000413734)** — MDI/MDIX information now shows "N/A" when doing a **show int brief**. It should show either MDI or MDIX.
- **Crash (PR\_1000410959)** — If the SNMPv3 user is deleted on the switch without deleting associated parameters and is then rebooted, the switch may reboot continuously giving a software exception error similar to:

```
Software exception at exception.c:373 -- in 'mSnmpEvt', task ID =  
0x17d1818 -> Memory system error at 0x17c22e0 - memPartFree
```

## Release Q.10.08

**Problems Resolved in Release Q.10.08** (Never released.)

## Release Q.10.09

**Problems Resolved in Release Q.10.09** (Never released.)

## Release Q.11.01

**Problems Resolved in Release Q.11.01** (Never released.)

- **System (PR\_1000412897)** — Configuring a port speed to 10 mbps does not work.
- **CLI (PR\_1000410952)** — When stacking, accessing a member switch through the commander's CLI may crash switch.
- **Crash (PR\_1000412287)** — The switch may crash when receiving a BPDU on a port configured with 802.1x authentication.
- **CLI (PR\_1000380660)** — The **show tech transceivers** command may display incorrect information when inserting certain transceivers into switch.
- **System (PR\_1000403054)** — The switch does not process CDP packets.
- **STP (PR\_1000382901)** — An auto-edge port link down state change may cause an STP topology change.
- **Logging (PR\_1000420713)** — The switch does not properly report excessive oversized or undersized packets.
- **Web UI (PR\_1000424035)** — Password sent in URL when using web interface
- **Web UI (PR\_1000416167)** — CA-signed certificate cannot be installed via the Web interface with the message:

error too large

- **Crash (PR\_1000418699)** — When using Web authentication, authenticating multiple clients on a port may cause a crash.
- **Crash (PR\_1000413907)** - The switch may crash when using the stacking menu.
- **CLI (PR\_1000416350)** — The **show span root-history msti <x>** does not show the correct priority.
- **Crash (PR\_1000420712)** — Enabling both Spanning Tree and MAC authentication may cause the switch to crash.
- **Web UI (PR\_1000429039)** — Changing the IP address via the Web interface incorrectly displays the subnet mask as IP address.
- **Crash (PR\_1000420722)** — The switch may crash when downloading a configuration report from the Web interface.
- **Web UI (PR\_1000405976)** — The Web UI allows deleting the startup-config file without reboot creating an inconsistent state.
- **Web UI (PR\_1000427213)** — The Upload/Download screen in Web interface has no scroll bars.
- **Trunk (PR\_1000395062)** — Trunking may not fail over properly from one link to the other.
- **Trunk (PR\_1000410057)** — Trunk failure may affect communication through other configured trunks.
- **Port Security (PR\_1000402594)** — The Switch may allow unauthorized MACs to be learned when using port security.
- **TIMEP (PR\_1000427372)** — "Timesync ?" incorrectly refers to network time protocol. It should be "TIME" protocol.
- **MSTP** — Various MSTP compliance fixes.

## Release Q.11.02

### Problems Resolved in Release Q.11.02

- **Web Auth (PR\_1000334982)** — A software exception might occur when Web authentication and an open VLAN is configured.

## Release Q.11.03

### Problems Resolved in Release Q.11.03 (Never released.)

- **Port Counters (PR\_1000440553)** — Port counters may erroneously report traffic on port 26.
- **Web-Auth (PR\_1000425595)** — The Web-Auth does not respond to DNS queries.
- **Network Connectivity (PR\_1000436184)** — Using multiple LACP trunks with MSTP may cause loss of network connectivity.
- **Crash (PR\_1000448326)** — MAC-Auth/Web-Auth crashes the switch.

## Release Q.11.04

### Problems Resolved in Release Q.11.04

- **Port Security (PR\_1000449644)** — Port Security used in conjunction with a 10-mbps port speed may cause the switch to crash.
- **Port Counters (PR\_1000373805)** — Menu port counters "total frames" does not include all transmit traffic.
- **OID (PR\_1000450982)** — The PortSlotOID definitions are incorrect.
- **Auto\_MDIX (PR\_1000452011)** — Auto-MDIX does not function correctly with fixed-speed ports. Each time that the switch is reloaded, it will report random MDI/MDIX values for each port.
- **Crash (PR\_1000453410)** — Stack member crashes repeatedly with a message similar to:  

```
TLB Miss: Virtual Addr=0x00000000 IP=0x800a84d4 Task='mSnmpEvt' Task  
ID=0x833edbf0 fp:0x00000000 sp:0x833eda38 ra:0x800a84cc sr:0x1000fc01
```

## Release Q.11.05

### Problems Resolved in Release Q.11.05

- **Hang/Reset (PR\_1000450986)** — The switch may experience a reset while booting, making the boot time longer. The switch may boot only from the primary flash image.

## Release Q.11.06

### Problems Resolved in Release Q.11.06

- **Product Support (PR\_1000461430)** — Support for J9019B has been added.
- **SNMP (PR\_1000406398)** — URL-embedded SNMP traps are not sent as SSL (https) when SSL is enabled, but they are instead sent as plain text (http). This may result in the trap receiver (PCM) unable to display the URL when SSL is enabled.
- **CLI (PR\_1000451000)** — Cancelling the **boot system flash (prilsec)** command sets the default boot image. Issuing a **reload** after canceling causes the switch to boot into the canceled flash image.

## Release Q.11.07

### Problems Resolved in Release Q.11.07

- **RX Counters (PR\_1000458490)** — The "Drops RX" counters increment on spanning tree-blocked ports.
- **Link (PR\_1000717137)** — Links may not come back up after enabling/disabling all ports.

## Release Q.11.08

### Problems Resolved in Release Q.11.08

- **IGMP (PR\_1000466842)** — IGMP drops multicast streams at random intervals, if there are two (2) or more streams. However, the first stream is not affected.
- **SNMP (PR\_1000715545)** — The switch sends unconfigured traps at boot up.
- **DST (PR\_1000467724)** — The DST change-over dates are incorrect for the Western-European time zone.
- **xSTP (PR\_1000330684)** — The spanning-tree help command text has been updated.
- **Counters (PR\_1000756649)** — The switch is incorrectly incrementing the IfInDiscard error counter.

## Release Q.11.09

### Problems Resolved in Release Q.11.09 (Not a public release.)

- **CLI (PR\_1000713515)** — The dialog associated with the CLI command **erase startup config** asks whether you want to save the config.
- **Config (PR\_1000400244)** — SNMP causes the switch to behave as though there has been a change to the running config, and therefore the switch prompts the user to “save the config,” even though no apparent changes have been made.
- **CLI (PR\_1000745696)** — The scheduled **reload** commands, **reload at** and **reload after**, appear to be inactive.
- **Port Security (PR\_1000772306)** — The switch may crash when the administrator tries to enable port security on gig ports. (Gig ports do not support port security.)

## Release Q.11.10

### Problems Resolved in Release Q.11.10 (Never released.)

- **Authentication (PR\_1000454714)** — Concurrent 802.1X and MAC-authentication does not give the 802.1X value precedence. This fix gives 802.1X VLAN assignment precedence over MAC auth RADIUS VLAN assignment.
- **Web (PR\_1000760153)** — A Java error occurs when viewing the "Stack Closeup" page of the ProCurve 2510-24 switch in the Web GUI. Only a blank screen is displayed.
- **CLI (PR\_1000430534)** — Output from the **show port-access mac-based** CLI command may omit connected clients.
- **Management Hang (PR\_1000779084)** — The switch management interface may become unresponsive as a result of packet buffer depletion.

## Release Q.11.11

### Problems Resolved in Release Q.11.11

- **Reboot error (PR\_0000001184)** — The switch may go into an infinite reboot cycle after a software update, and displays an error message similar to:

```
Config Error - Initialization Stopped
```

## Release Q.11.12 (Never released)

### Problems Resolved in Release Q.11.12

- **System Up-time (1000772402)** — The system up-time rolls back to zero after 49 days.
- **RADIUS/Jumbo (PR\_1000779048)** — When an 802.1X-enabled port belongs to a VLAN that is jumbo enabled, the Access-Request will specify a value of Framed-MTU of 9182 bytes. When the RADIUS server replies with a large frame, the switch does not respond, causing the authentication process to halt.
- **Web Auth (PR\_1000380278)** — After running for a period, the switch will get into a state in which it must be rebooted in order for the Web authentication page to load.
- **Enhancement (PR\_1000793342)** — The Auto-10-100 parameter was added as a port configuration option for speed-duplex. For further information, please see [“Release Q.11.12 Enhancements” on page 12](#).
- **Crash (1000790482)** — When MAC-based or Web-based port access is configured for dual personality ports, the switch may crash with a message similar to the following.

```
Software exception at hp53xx_port.c:2781 -- in 'mAdMgrCtrl',  
task ID = 0x8347f560 -> internal error
```

- **Crash (PR\_0000001756)** — Configuration of VLANs and VLAN port assignment using SNMP may cause the switch may crash with a message similar to the following.

```
Software exception at bcmHwVlans.c:149 -- in 'mAdMgrCtrl',  
task ID = 0x18636e8 -> ASIC call failed: Entry not found.
```

- **Crash (PR\_1000795039)** — The switch may crash while uploading the configuration file, if there are extra space(s) in the configuration file header. The message is similar to the following.

```
TLB Miss: Virtual Addr=0x00000000 IP=0x804cfd80 Task='mftTask'  
Task ID=0x83357880 fp:0x83357678 sp:0x83357608 ra:0x804cfe10  
sr:0x1000fc01
```

## Release Q.11.13 (Not a public release)

### Problems Resolved in Release Q.11.13

- **SNMP (0000003172)** — The Procurve 2510-24 (J9019B) uses the same sysOID as the ProCurve 1800-24G (J9028B). This fix resolves the conflict by assigning an OID value of 1.3.6.1.4.1.11.2.3.7.11.90 to the ProCurve 2510-24 Switch (J9019B).

## Release Q.11.14 (Not a public release)

### Problems Resolved in Release Q.11.14

- **UDLD (PR\_0000002473)** — UDLD protocol packets received on a (non-UDLD) trunk port are incorrectly forwarded out of the same port from which they are received, resulting in high CPU usage on the switch.
- **Crash (PR\_0000005374)** — Enabling snmpv3 on the switch may result in a crash with a message similar to the following.

```
TLB Miss: Virtual Addr=0x00000009 IP=0x800a861c Task='mSnmpEvt' Task
ID=0x833d51a0 fp:0x8334bec0 sp:0x833d4fe8 ra:0x800a858
csr:0x1000fc01
```

- **TACACS+ (PR\_0000003010)** — The switch does not allow single manager sign-on using TACACS+.

## Release Q.11.15 (Never released)

### Problems Resolved in Release Q.11.15

No problems were fixed, nor enhancements introduced.

## Release Q.11.16 (Never released)

### Problems Resolved in Release Q.11.16

- **TACACS+ (PR\_0000003839)** — The TACACS server configuration parameter accepts an address from an invalid/reserved IP range: 0.0.0.1 to 0.255.255.255.
- **Enhancement (PR\_1000406763)** — New command output was added to the CLI response to the **show tech** command. For further information, please see [“Release Q.11.16 Enhancements” on page 14](#).
- **Enhancement (PR\_0000010783)** — Support was added for the following products.

```
J9099B - ProCurve 100-BX-D SFP-LC Transceiver
J9100B - ProCurve 100-BX-U SFP-LC Transceiver
J9142B - ProCurve 1000-BX-D SFP-LC Mini-GBIC
J9143B - ProCurve 1000-BX-U SFP-LC Mini-GBIC
```

For further information, please see [“Release Q.11.16 Enhancements” on page 14](#).

## Release Q.11.17

### Problems Resolved in Release Q.11.17

- **Web (PR\_0000011479)** — The HP ProCurve 1000 BX and 1000 LH mini-GBICs were neither visible nor configurable in the Web Management Interface config screen.
- **Transceivers (PR\_0000010525)** — Intermittent self test failure may occur if transceivers are hot-swapped in and out of the switch in too short a time frame. Note that even with this fix, transceivers should always be allowed to initialize fully prior to removal and subsequent re-insertion.

*Best Practice Tip:* Upon hot insertion of a transceiver, the mode LED will come on for two seconds. Once this LED has extinguished, it is once again safe to remove the transceiver.



© 2008  
Hewlett-Packard Development Company, LP.  
The information contained herein is subject to  
change without notice.

October 2008  
Manual Part Number  
5991-6274